

Newell Coach Corporation

3900 North Main St. Miami, OK. 74354

918-542-3344, Fax: 918-542-7120

Invoice

INVOICE NO.	PAGE
96093	1
INVOICE DATE	
4/2/2024	

BILL TO:

COACH:

COACH-1746
 2023 NEWELL COACH
 1N9458183P1011746
 ODOMETER: 18,443
 GEN HOURS: 287

SERVICE ADVISOR 1	SERVICE ADVISOR 2	ORDER NO.	ORDER DATE	CUSTOMER NO.
Matt Kirkwood		23150	2/12/2024	92433

LINE NO	TASK/ITEM	DESCRIPTION	QUANTITY	UOM	UNIT PRICE	EXTENDED PRICE
1	Move	Move coach in & out				Labor: 0.00
		Complaint: Move coach in and get mileage and gen hours Cause: service procedure Cure: 18443 miles Gen 287 hours				
2	A1	Non Chargeable Services, Scheduled				Labor: 0.00
		Complaint: Customer states he cannot connect to the coach. Unsure if cradle point is not seeing the sim cards. Cause: Working properly. Cure: The cradle point is working properly and the sim card is working also. The Intrepid app does not allow remote access to the cameras this is by design. There is a zozy DVR installed in the coach that allows access to the cameras. The customer just needs to download the app and create an account.				
3	PM	Preventive Maintenance, Chargeable				Labor: 2,750.00
		Complaint: PM per check list Cause: annual maintenance Needs right rear flood light due to 3 LEDs burned out. Cure: Electrical PM complete HVAC PM complete Mechanic PM complete complete 510				

Continued....

Newell Coach Corporation

3900 North Main St. Miami, OK. 74354

918-542-3344, Fax: 918-542-7120

Invoice

INVOICE NO.	PAGE
96093	2
INVOICE DATE	
4/2/2024	

BILL TO:

COACH:

COACH-1746
 2023 NEWELL COACH
 1N9458183P1011746
 ODOMETER: 18,443
 GEN HOURS: 287

SERVICE ADVISOR 1	SERVICE ADVISOR 2	ORDER NO.	ORDER DATE	CUSTOMER NO.
Matt Kirkwood		23150	2/12/2024	92433

LINE NO	TASK/ITEM	DESCRIPTION	QUANTITY	UOM	UNIT PRICE	EXTENDED PRICE
	S19097	NOZZLE,AQUA-HOT,42911200W0.35 60SF, WPX-886-41A	2.00		25.96	51.92
	S600470	FUEL FILTER #FLE-120-100 AQUAHOT	2.00		32.00	64.00
	S14062	EVERPURE FILTER CARTRIDGE #2 THM#2 EV960136	2.00		51.99	103.98
	S14063	EVERPURE FILTER CARTRIDGE #1 THM#1 EV960126	2.00		70.99	141.98
	405540	CARBON MONOXIDE ALARM 10YR BAT FIRST ALERT CO710	1.00		139.99	139.99
	804890	SMOKE DETECTOR DUAL SENSOR FIRST ALERT SA3210	2.00		81.30	162.60
	713450	GE REFRIGERATOR WATER FILTER AMAZON XWFE	1.00		99.98	99.98
	707250	LFP9001 OIL FILTER LFP9001 CUMMINS ISX ENGINE	1.00		49.99	49.99
	S106690	LAF8195 FILTER AIR MARTIN 20KW GENERATOR	1.00		22.99	22.99
	S712810	OIL FILTER MARTIN GEN T4 YANMAR 129150-35170	1.00		13.99	13.99
	S712790	FUEL FILTER MARTIN GEN T4 YANMAR 129A00-55800-HD	1.00		89.99	89.99
	S710430	FF5825 FILTER FUEL FLEETGUARD #FF5776	1.00		121.99	121.99
	700900	LFP8654 FILTER AIR DRYER	1.00		59.99	59.99
	S707670	WINDSHIELD WIPER WASHER FLUID 1 GALLON BLUE	1.00		4.99	4.99
	S708250	FILTER FUEL 10 MCRN FLEETGARD #FS19764G	1.00		42.99	42.99
	11765	GREASE MOBIL SHC-460 TUBE60 TU	1.00		29.99	29.99
	706770	BIOCIDE TREATMENT DIESEL FUEL BIO KLEEN # 9016-06 16oz	1.00		75.30	75.30
	113280	BALDWIN AIR FILTER PA2723 (REPLACES 104840)	1.00		314.53	314.53
	109430	OIL MOTOR DELVAC EXTREME BULK MINERAL BLEND	59.50		10.99	653.91
4	A1	Non Chargeable Services, Scheduled			Labor:	0.00
		Complaint: Dishwasher knock/lock inop. Cause: Bad knock sensor.				

Continued....

Newell Coach Corporation

3900 North Main St. Miami, OK. 74354

918-542-3344, Fax: 918-542-7120

Invoice

INVOICE NO.	PAGE
96093	3
INVOICE DATE	
4/2/2024	

BILL TO:

COACH:

COACH-1746
 2023 NEWELL COACH
 1N9458183P1011746
 ODOMETER: 18,443
 GEN HOURS: 287

SERVICE ADVISOR 1	SERVICE ADVISOR 2	ORDER NO.	ORDER DATE	CUSTOMER NO.
Matt Kirkwood		23150	2/12/2024	92433

LINE NO	TASK/ITEM	DESCRIPTION	QUANTITY	UOM	UNIT PRICE	EXTENDED PRICE
5	85	<p>Cure: I programmed the dishwasher and it locks now but the knock sensor is not working. I took the front off of the dishwasher and took the knock sensor off and gave it to Matt to order a new one. 2/12/24</p> <p>Replacement dishwasher unit ordered 2-12-24 (MRK)</p> <p>Removed/replaced the faulty dishwasher, Verified knock/lock operation pulled front of dishwasher, pulled drawer and screwed cabinet in place, reinstalled front, set lock settings</p> <p>DISHWASHER, DRAWER TYPE FISHER&PAYKEL DD24SI9</p>	1.00			
5	003	Chargeable Services, Scheduled			Labor:	0.00
6	A2	<p>Complaint: I suspect the low voltage from the inverter did the trick. Please make sure they look at the arm too as it floats and triggers the disconnected arm lights</p> <p>Cause: Disregard</p> <p>Cure: Disregard repaired last visit</p> <p>Non Chargeable Service, Scheduled</p> <p>Complaint: Mid toilet is no flush only fill, read previous work order, cannot find screens in belly to clean. I do not think they are installed on this coach with the "new" toilets. Please be prepared to install and fix the toilet ongoing flush issue. Installed cleanable screens so toilets do not have to be removed. BTW, I run a three filter system for all water in the coach to .2 micron this should not be happening.</p> <p>Cause: clogged screens</p> <p>Cure: took both toilets out removed the screens in them put back tested works</p>			Labor:	0.00

Continued....

Newell Coach Corporation

3900 North Main St. Miami, OK. 74354

918-542-3344, Fax: 918-542-7120

Invoice

INVOICE NO.	PAGE
96093	4
INVOICE DATE	
4/2/2024	

BILL TO:

COACH:

COACH-1746
 2023 NEWELL COACH
 1N9458183P1011746
 ODOMETER: 18,443
 GEN HOURS: 287

SERVICE ADVISOR 1	SERVICE ADVISOR 2	ORDER NO.	ORDER DATE	CUSTOMER NO.
Matt Kirkwood		23150	2/12/2024	92433

LINE NO	TASK/ITEM	DESCRIPTION	QUANTITY	UOM	UNIT PRICE	EXTENDED PRICE
	603050	INLINE STRAINER 1" FPT 10 MESH HEADHUNTER ILS-1000	1.00			
	603060	ADAPTER 1" NPT X 1" PEX POLY SUPPLY GIANT QQNB1010-5	2.00			
	713930	MOUNTING SNUB (PACK OF 4) HEADHUNTER MISC	1.00			
	S5409	SILICONE WORK SITE 10.3 OZ. CLEAR 33SC	1.00			
7	A1	Non Chargeable Services, Scheduled			Labor:	0.00
		Complaint: Trailer Brake airline pull (not parking brake) is impossible in engage or disengage, needs to be replaced. Please bring parts. The red one not the yellow one. ,				
		Cause: seized switch				
		Cure: Replace trailer brake air supply valve. Hook up air hose connector and verify operation and air flow to trailer fitting at rear of coach.				
	108220	VALVE PUSH/PULL BENDIX 287282	1.00			
	109690	COUPLER SOCKET 3/8" HANSEN 4300	1.00			
8	A1	Non Chargeable Services, Scheduled			Labor:	0.00
		Complaint: Plug still not working for Sofa mattress inflation or leg rest in sofa. Listed on previous order not addressed, Exterior TV seems to also not have power. All may be on the same circuit, have checked N1 panel, all breakers in belly and rear closet. This started when 30 amp inverter blew. Suspect a blown breaker somewhere, due to the inverter issue.				
		Cause: Check panel circuit breakers for sofa circuit. No flipped breakers found. Test plug receptacle to the sofa and it tests good voltage. Test air mattress pump and found it has failed. Test sofa electrical circuit. Found no power out of the 120 volt to 12 volt power supply. The power supply has failed.				

Continued....

Newell Coach Corporation

3900 North Main St. Miami, OK. 74354

918-542-3344, Fax: 918-542-7120

Invoice

INVOICE NO.	PAGE
96093	5
INVOICE DATE	
4/2/2024	

BILL TO:

COACH:
 COACH-1746
 2023 NEWELL COACH
 1N9458183P1011746
 ODOMETER: 18,443
 GEN HOURS: 287

SERVICE ADVISOR 1	SERVICE ADVISOR 2	ORDER NO.	ORDER DATE	CUSTOMER NO.
Matt Kirkwood		23150	2/12/2024	92433

LINE NO	TASK/ITEM	DESCRIPTION	QUANTITY	UOM	UNIT PRICE	EXTENDED PRICE
9	A1	Cure: Replace air mattress pump and bladder assembly. Replace 110 volt to 12 volt power supply for the sofa. 714020 52"X72" AIR MATTRESS BLADDER L&P LEGPLT601462 INTERNAL PUMP Transformer, low voltage 200s, IP67 Non Chargeable Services, Scheduled	1.00 1.00			Labor: 0.00
10	A1	Complaint: Front sunshade needs to be adjusted to retract higher, right mirror blocked. From last work order Cause: unknown Cure: adjusted the up limit on sunscreen Non Chargeable Services, Scheduled				Labor: 0.00
11	A1	Complaint: Co Pilot seat still squeeks. From last work order Cause: allum plate under copilot chair squeeking when stepped on Cure: unbolt pass seat set out of way removed lower dash access panel glove box section accelorater peddle busted tile up and heat mat under layment and removed alum plate cnc cut new plate and under layment fit plate and installed attached new chair plate put down under layment and heat mat cut and fit new tile and installed groutedcleaned floor put every thing back 202330 BRACKET COPILOT SEAT KEMLEE MFG 303910 RELAY 12V 20A SPDT FLANGE MT NEWARK #92F3729 / T9AP5D52-12 Tile, 35x35 borigni blk, A41BORIBK3535 Tile, 35x35 borigni blk, A41BORIBK3535 Non Chargeable Services, Scheduled	1.00 1.00 34.37 51.56			Labor: 0.00
		Complaint: Dishwasher, knock to unlock and auto lock issue. Cause: Duplicate line Cure: Duplicate line				

Continued....

Newell Coach Corporation

3900 North Main St. Miami, OK. 74354

918-542-3344, Fax: 918-542-7120

Invoice

INVOICE NO.	PAGE
96093	6
INVOICE DATE	
4/2/2024	

BILL TO:

COACH:

COACH-1746
 2023 NEWELL COACH
 1N9458183P1011746
 ODOMETER: 18,443
 GEN HOURS: 287

SERVICE ADVISOR 1	SERVICE ADVISOR 2	ORDER NO.	ORDER DATE	CUSTOMER NO.
Matt Kirkwood		23150	2/12/2024	92433

LINE NO	TASK/ITEM	DESCRIPTION	QUANTITY	UOM	UNIT PRICE	EXTENDED PRICE
12	A1	Non Chargeable Services, Scheduled				Labor: 0.00
		Complaint: Random air leak seal around front door area, causes compressor to run				
		Cause: mac valve was externally bypassing supply air.				
		Cure: Replaced faulty mac valve and adjusted entry door open/close speed.				
	707680	SEAL ROOM VALID #PRS30619-2 BIG	1.00			
	109000	SOLENOID DOUBLE 1/8" 12V BODE # 0058.68	1.00			
13	A1	Non Chargeable Services, Scheduled				Labor: 0.00
		Complaint: #4 Slide seal leaking				
		Cause: Hole in seal just fwd of fill tube				

Continued....

Newell Coach Corporation

3900 North Main St. Miami, OK. 74354

918-542-3344, Fax: 918-542-7120

Invoice

INVOICE NO.	PAGE
96093	7
INVOICE DATE	
4/2/2024	

BILL TO:

COACH:
 COACH-1746
 2023 NEWELL COACH
 1N9458183P1011746
 ODOMETER: 18,443
 GEN HOURS: 287

SERVICE ADVISOR 1	SERVICE ADVISOR 2	ORDER NO.	ORDER DATE	CUSTOMER NO.
Matt Kirkwood		23150	2/12/2024	92433

LINE NO	TASK/ITEM	DESCRIPTION	QUANTITY	UOM	UNIT PRICE	EXTENDED PRICE
		<p>Cure: Verified and located leak in seal. Removed outer bearing covers and removed upper room valance and wire cover ran room in slightly and removed outer bearing covers and unhooked zippers and removed and marked shims. Removed endwalls and inner bearing covers. Unbolted Z bars and motor arms and placed room on jack table. Removed room from coach and stabilized. Removed stainless retaining strips and removed old seal. Cleaned and cleaned and cleaned urethane sealant from seal retainer so new seal would install correctly.</p> <p>Cleaned more sealant/adhesive from retainer. Located and placed new seal in coach. Inserted seal into retainer and cut to length and created the splice/termination. Inflated seal and checked for leaks. Discovered a "flap" in fill tube and had to drill it out. Inflated seal and checked for leaks and operation. Installed new stainless retaining strips and screws. Sealed with urethane and created dam at splice area.</p> <p>Installed room back in coach and hooked up motor arms and Z bars. Ran room in slightly and hooked up zippers. Checked for clearance and ran room. Room was out of adjustment and had to be adjusted.</p> <p>room was out of adjustment when we slid it back in had to raise the front a 1/8 and tilted both sides in runs good</p> <p>Reinstalled interior walls, bearing covers and valance. Ran room several times on customer run mode. Adjusted seal pressure to 21 psi. Monitoring seal expansion to make sure it expands fully from new.</p>				
713890		RETAINER, SEAL WIPER, 42" VALID VSS50P-041-01	11.00			
S402170		GLUE ACCELERATOR PERMABOND 4OZ # QFS16 4 oz	1.00			
S402980		GLUE SUPER GEL TUBE 20 GR PERMABOND #2011	1.00			
713800		VERTICAL ADJ. PLATE .125" IEW VALID VSS10P-131-09	1.00			

Continued....

Newell Coach Corporation

3900 North Main St. Miami, OK. 74354

918-542-3344, Fax: 918-542-7120

Invoice

INVOICE NO.	PAGE
96093	8
INVOICE DATE	
4/2/2024	

BILL TO:

COACH:
 COACH-1746
 2023 NEWELL COACH
 1N9458183P1011746
 ODOMETER: 18,443
 GEN HOURS: 287

SERVICE ADVISOR 1	SERVICE ADVISOR 2	ORDER NO.	ORDER DATE	CUSTOMER NO.
Matt Kirkwood		23150	2/12/2024	92433

LINE NO	TASK/ITEM	DESCRIPTION	QUANTITY	UOM	UNIT PRICE	EXTENDED PRICE
14	TPR	Check and Adjust Front Tire Pressures and Get date code				Labor: 0.00
		Complaint: Check tire pressure and get DOT #s Cause: service procedure Cure: dt4021 dd3321 df4021 pt3921 pd3321 pf4021 set front tires to 120psi				
15	Cover	Cover floor/clean up				Labor: 0.00
		Complaint: Cover floor and clean up Cause: service procedure Cure: pulled plastic wiped down walls windows seats vacuumed floor and moped floor				
16	003	Chargeable Services, Scheduled				Labor: 0.00
		Complaint: Wants both toilets updated to external easier to service filters/screens Cause: customer request Cure: see line #6				
17	003	Chargeable Services, Scheduled				Labor: 234.00
		Complaint: Front awning lands very loud and has wear patters indicating misalignment. Cause: Fwd arm had shifted at leadrail connection				

Continued....

Newell Coach Corporation

3900 North Main St. Miami, OK. 74354

918-542-3344, Fax: 918-542-7120

Invoice

INVOICE NO.	PAGE
96093	9
INVOICE DATE	
4/2/2024	

BILL TO:

COACH:
 COACH-1746
 2023 NEWELL COACH
 1N9458183P1011746
 ODOMETER: 18,443
 GEN HOURS: 287

SERVICE ADVISOR 1	SERVICE ADVISOR 2	ORDER NO.	ORDER DATE	CUSTOMER NO.
Matt Kirkwood		23150	2/12/2024	92433

LINE NO	TASK/ITEM	DESCRIPTION	QUANTITY	UOM	UNIT PRICE	EXTENDED PRICE
18	TPR	<p>Cure: Ran awning and verified misalignment and observed that the fwd arm had shifted on the leadrail, leaving scratches. Measured and verified the arm to be one-half inch out of location. Loosened the set screws and moved it back and re-tightened. Ran awning to verify difference. Much better but still not centered. Adjusted fabric to shift leadrail towards aft of coach. Ran awning and it parked well. Ran awning two more times to verify. Touched up paint on the leadrail end cap. After paint dried ran awning two more times and worked good.</p> <p>Check and Adjust Front Tire Pressures and Get date code</p>			Labor:	0.00
19	COVER	<p>Complaint: Check tire pressure and get DOT #'s Cause: Duplicate line Cure: Duplicate line</p> <p>Cover floor/clean up</p>			Labor:	0.00
20	A1	<p>Complaint: Driver overhead center screen has incorrect size and image. Cause: Update. Cure: I updated the CCI and the GCI screens and checked the back end to make sure all the resolution setting were correct. I also updated the valid controller. I also changed the flood light on the driver left side.</p> <p>Non Chargeable Services, Scheduled</p>			Labor:	0.00

Continued....

Newell Coach Corporation

3900 North Main St. Miami, OK. 74354

918-542-3344, Fax: 918-542-7120

Invoice

INVOICE NO.	PAGE
96093	10
INVOICE DATE	
4/2/2024	

BILL TO:

COACH:

COACH-1746
 2023 NEWELL COACH
 1N9458183P1011746
 ODOMETER: 18,443
 GEN HOURS: 287

SERVICE ADVISOR 1	SERVICE ADVISOR 2	ORDER NO.	ORDER DATE	CUSTOMER NO.
Matt Kirkwood		23150	2/12/2024	92433

LINE NO	TASK/ITEM	DESCRIPTION	QUANTITY	UOM	UNIT PRICE	EXTENDED PRICE
21	A1	Non Chargeable Services, Scheduled				Labor: 0.00
		Complaint: coolant leaking from front of the coach Cause: water pummp leaking on generator.				
		Cure: Replacement pump ordered 2-12-24 (MRK) replaced the water pump on the gen put all new gaskets on the pump.I also purged all air out of the coolant system. Before i put the water pump on i soaked the pump in coolant so it wouldnt hurt the seal on the pump. I also loaded the gen with another coach and ran all A/C on the coach i was working on got the gen to temp for several hrs all was good				
		105380 CLAMP 13/16"-1 3/4" CONST TORQ BREEZE # CT-9420	2.00			
		107440 ANTIFREEZE MOBIL DELVAC 50/50 PREDILUTED EXTENDED LIFE	4.00			
		129486-42021 Gasket water pump	1.00			
		129c84-42001 water pump	1.00			
		129155-49801 Thermostat	1.00			
		129795-49551 Cover Gasket	1.00			
		129150-49811 Thermostat Gasket	1.00			
		129486-42140 O ring	1.00			
22	A1	Non Chargeable Services, Scheduled				Labor: 0.00
		Complaint: Water pump leaking Cause: leaking Cure: was leaking under the legs removed and replaced took the old one to stock room to have it shipped back for warranty tested new one works				
		600050 PUMP WATER 115V AC MACH 5 HEADHUNTER M5-115	1.00			
23	Chip windshield	Repair chip in windshield				Labor: 60.00
		Complaint: Stone chip in the windshield Cause: road debris Cure: repair and sel 1 chip drivers side, seal 1 pit pass side				

Continued....

Newell Coach Corporation

3900 North Main St. Miami, OK. 74354

918-542-3344, Fax: 918-542-7120

Invoice

INVOICE NO.	PAGE
96093	11
INVOICE DATE	
4/2/2024	

BILL TO:

COACH:

COACH-1746
 2023 NEWELL COACH
 1N9458183P1011746
 ODOMETER: 18,443
 GEN HOURS: 287

SERVICE ADVISOR 1	SERVICE ADVISOR 2	ORDER NO.	ORDER DATE	CUSTOMER NO.
Matt Kirkwood		23150	2/12/2024	92433

LINE NO	TASK/ITEM	DESCRIPTION	QUANTITY	UOM	UNIT PRICE	EXTENDED PRICE
24	DP	Paint Services Adjustment, Non Chargeable				Labor: 0.00
		Complaint: Fix paint on step cover, damaged by transporter, pilot error. Newell estimate \$1200, last visit				
		Cause: damage				
		Cure: removed step, sanded, filled chips, sanded bondo, masked step & coach, sprayed primer, sanded primer, blew off, wiped with cleaner, painted white, masked 1/4 inch stripe, sprayed pearl stripe, sprayed shadow on pearl, sprayed sanding clear, sanded, blew off, wiped with cleaner, tacked, sprayed clear, unmasked, installed step, installed stainless pieces				
	MIXPAINT	MIXING PAINT, VARIOUS COLORS	0.50			
25	UA2P	Non Chargeable Paint Services, Unscheduled				Labor: 0.00
		Complaint: Paint cracking on trim piece at joint, left front; Paint chipped off quarter size on radiator door				
		Cause: cracked paint				
		Cure: removed rear engine door, masked coach, sanded rear lower corner, filled chips, sanded bondo, primed, sanded front moulding, primed, sanded primer spots, blew off, wiped with cleaner, sprayed test panels for blue, black fade on rear corner, sprayed fade on rear corner, masked, masked moulding, sprayed white, masked 3/8 stripe, sprayed pearl stripe, masked, sprayed bronze, unmasked front moulding & rear corner, blew off, tacked, sprayed clear, sanded clear, blew off, wiped with cleaner, taked, sprayed clear, unmasked coach, installed side engine door, blacked out				
	207380	TRIM BLINKER STEPS KEMLEE MFG	1.00			
	207170	TRIM ENTRY DOOR LOWER KEMLEE MFG	1.00			
	MIXPAINT	MIXING PAINT, VARIOUS COLORS	1.50			

Continued....

Newell Coach Corporation

3900 North Main St. Miami, OK. 74354

918-542-3344, Fax: 918-542-7120

Invoice

INVOICE NO.	PAGE
96093	12
INVOICE DATE	
4/2/2024	

BILL TO:

COACH:
 COACH-1746
 2023 NEWELL COACH
 1N9458183P1011746
 ODOMETER: 18,443
 GEN HOURS: 287

SERVICE ADVISOR 1	SERVICE ADVISOR 2	ORDER NO.	ORDER DATE	CUSTOMER NO.
Matt Kirkwood		23150	2/12/2024	92433

LINE NO	TASK/ITEM	DESCRIPTION	QUANTITY	UOM	UNIT PRICE	EXTENDED PRICE
26	A1	Non Chargeable Services, Scheduled				Labor: 0.00
		Complaint: Correct bay light wiring. Cause: No ground signal from L7 bay and rear engine door Cure: The N1 panel was not receiving a ground signal in the pinout location for L7 bay and the rear engine door. Since L7 bay does not exist and the rear engine door has no ground coming from the latch, I added ground wiring to simulate the presence of ground. Now, the bay lights shut off when the bays are closed as designed.				
27	A1	Non Chargeable Services, Scheduled				Labor: 0.00
		Complaint: Driver forward belt rail lighting inop Cause: Deteriorated junction in belt rail lighting Cure: Replaced the entire DS belt rail lighting. Butt spliced and heat shrunk the connection instead of soldering to keep from having the junction corrode again.				
	311250	LIGHT STRIP LED RGB 5M BLK PCB CAREFREE R060733-001	3.00			
28	UPH	Chargeable Services, Upholstery				Labor: 550.00
		Complaint: Trim a radius into the mattress pad per customer request. Cause: customer request Cure: trimmed mattress pad				
29	A1	Non Chargeable Services, Scheduled				Labor: 0.00

Continued....

Newell Coach Corporation

3900 North Main St. Miami, OK. 74354

918-542-3344, Fax: 918-542-7120

Invoice

INVOICE NO.	PAGE
96093	13
INVOICE DATE	
4/2/2024	

BILL TO:

COACH:

COACH-1746
 2023 NEWELL COACH
 1N9458183P1011746
 ODOMETER: 18,443
 GEN HOURS: 287

SERVICE ADVISOR 1	SERVICE ADVISOR 2	ORDER NO.	ORDER DATE	CUSTOMER NO.
Matt Kirkwood		23150	2/12/2024	92433

LINE NO	TASK/ITEM	DESCRIPTION	QUANTITY	UOM	UNIT PRICE	EXTENDED PRICE
---------	-----------	-------------	----------	-----	------------	----------------

Service credit for half of the billing for J 1.00
Sublet Labor: -707.75

Complaint: Service credit for half of JJs travel expenses.
 Customer covered the other half.

\$707.75

Cause:
 Cure:

Summary	PARTS: 2,245.10	SUBLET PARTS: 0.00	INBOUND FREIGHT 0.00
	LABOR: 3,594.00	SUBLET LABOR: -707.75	OUTBOUND FREIGHT 0.00

SALE AMOUNT	5,131.35
EPA CHARGES	143.76
FREIGHT	0.00
SALES TAX	243.59
TOTAL	5,518.70
(CREDIT APPLIED)	109.02
(AMOUNT PAID)	5,409.68
BALANCE DUE	0.00